




TORNADO


One Of HDD's Favorite Reamers With Aggressive Pumping Action For Everthing From Sticky Clay To Hard Shale.

TORNADO Shaft Diameter & Thread					
Cut Diameter	2.75"	3.25"	4.25"	4.75"	6.5"
	2" IF box X box	2-3/8" Reg box X box	2-7/8" IF box X box	3-1/2" IF box X box	4-1/2" IF box X box
6"	90-06-21F-21F				
8"	90-08-21F-21F	90-08-23F-23F	90-08-27F-27F		
10"	90-10-21F-21F	90-10-23F-23F	90-10-27F-27F		
12"	90-12-21F-21F	90-12-23F-23F	90-12-27F-27F	90-12-29F-29F	
14"	90-14-21F-21F	90-14-23F-23F	90-14-27F-27F	90-14-29F-29F	90-14-47F-47F
16"	90-16-21F-21F	90-16-23F-23F	90-16-27F-27F	90-16-29F-29F	90-16-47F-47F
18"	90-18-21F-21F	90-18-23F-23F	90-18-27F-27F	90-18-29F-29F	90-18-47F-47F
20"	90-20-21F-21F	90-20-23F-23F	90-20-27F-27F	90-20-29F-29F	90-20-47F-47F
24"		90-24-23F-23F	90-24-27F-27F	90-24-29F-29F	90-24-47F-47F
28"		90-28-23F-23F	90-28-27F-27F	90-28-29F-29F	90-28-47F-47F
30"			90-30-27F-27F	90-30-29F-29F	90-30-47F-47F
34"			90-34-27F-27F	90-34-29F-29F	90-34-47F-47F
36"			90-36-27F-27F	90-36-29F-29F	90-36-47F-47F
38"			90-38-27F-27F	90-38-29F-29F	90-38-47F-47F
40"			90-40-27F-27F	90-40-29F-29F	90-40-47F-47F
42"			90-42-27F-27F	90-42-29F-29F	90-42-47F-47F
48"				90-48-29F-29F	90-48-47F-47F

BEST FOR:




GOOD FOR:



Gusseted blades for extra strength

Blade cut-outs allow flow-through of slurry

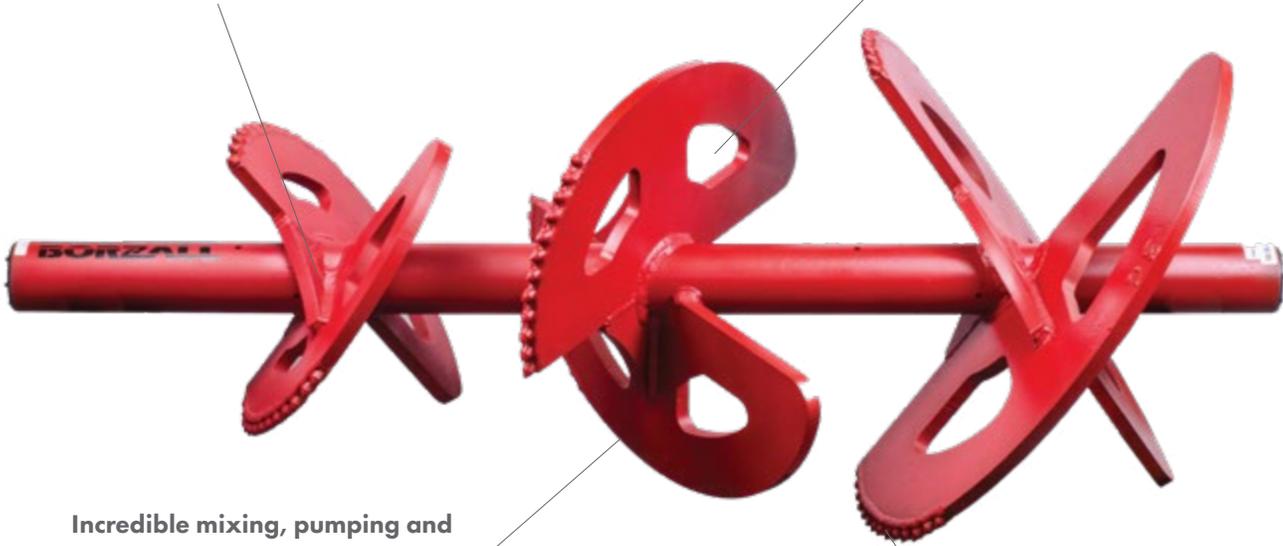

Incredible mixing, pumping and cutting action reduces rotary pressure and makes it an ideal reamer for sticky situations

Carbide-tipped cutting blades are precisely positioned and angled so all the abuse is placed on the carbide tooth

HOUSINGS

DIRECT PULLBACK

BITS & BLADES

DIRECT & QUICK-DISCONNECTS

REAMERS

SWIVELS

PULLERS

ADAPTERS & SUB-SAVERS

PARTS & ACCESSORIES